

**Final
Site-Specific Unexploded Ordnance Safety Plan Attachment
Site Investigation at Chemical Warfare Material Sites
Agent ID Area (Parcel 509), Training Area T-6 (Naylor Field)
(Parcel 183), Blacktop Training Area (Parcel 511), Fenced
Yard in Blacktop Area (Parcel 512), Dog Training Area (Parcel
513), Dog Kennel Area (Parcel 516), Training Area T-5 (Parcel
182), Former Detection and Identification Area (Parcel 180),
Old Burn Pit (Parcel 514), CBR Proficiency Area (Parcel 517),
and Old Toxic Training Area (Parcel 188)**

Fort McClellan, Calhoun County, Alabama

Prepared for:

**U.S. Army Corps of Engineers, Mobile District
109 St. Joseph Street,
Mobile, Alabama 36602**

Prepared by:

**IT Corporation
312 Directors Drive
Knoxville, Tennessee 37923**

**Task Order CK10
Contract No. DACA21-96-D-0018
IT Project No. 796887**

October 2000

Revision 1

Table of Contents

	Page
List of Acronyms	ii
1.0 Introduction	1
2.0 UXO Team Composition	2
3.0 Responsibilities	2
4.0 Authority	3
5.0 Anomaly Avoidance Procedures for Sampling Activities.....	3
6.0 UXO/OE Disposition	6
7.0 Safety.....	6
8.0 Quality.....	7
9.0 Reference.....	7

List of Acronyms

See Attachment 1, List of Abbreviations and Acronyms, of the Site-Specific Field Sampling Plan Attachment contained in this binder.

1.0 Introduction

This document defines anomaly avoidance procedures for activities to be performed by IT Corporation (IT) in conjunction with the site investigation (SI) activities at the Chemical Warfare Material (CWM), Parcels 509(7), 183(6), 511(7), 512(7), 513(7), 516(7), 182(7), 180(7), 514(7), 517(7), and 188(7), at Fort McClellan (FTMC), Calhoun County, Alabama. IT will perform visual surveys and collect surface soil, subsurface soil, groundwater, surface water, and sediment samples for chemical analysis at the CWM sites. In performing these activities, IT will require unexploded ordnance (UXO) anomaly avoidance services to avoid any potential surface UXO or subsurface anomalies during sampling activities. Intrusive anomaly investigation is not authorized for this SI work.

The CWM sites, Parcels 509(7), 183(6), 511(7), 512(7), 513(7), 516(7), 182(7), 180(7), 514(7), 517(7), and 188(7), are located in the southeast area of the Main Post. The CWM sites that will be investigated in this SI are the following:

- ⊗ Agent ID Area, Parcel 509(7)
- ⊗ Training Area T-6 (Naylor Field), Parcel 183(6)
- ⊗ Blacktop Training Area, Parcel 511(7)
- ⊗ Fenced Yard in Blacktop Area, Parcel 512(7)
- ⊗ Dog Training Area, Parcel 513(7)
- ⊗ Dog Kennel Area, Parcel 516(7)
- ⊗ Training Area T-5, Parcel 182(7)
- ⊗ Former Detection and Identification Area, Parcel 180(7)
- ⊗ Old Burn Pit, Parcel 514(7)
- ⊗ Chemical, Biological, and Radioactive Proficiency Area, Parcel 517(7)
- ⊗ Old Toxic Training Area, Parcel 188(7).

Specific site descriptions are presented in Section 1.3 of the site-specific field sampling plan attachment for each of the CWM sites included in this SI.

Prior to IT conducting any field work at these sites, the U.S. Army Corps of Engineers-Huntsville will clear the sites for CWM. Therefore, data related to CWM will not be collected as part of this site investigation. A CWM investigation will be provided in the CWM engineering evaluation/cost analysis that is being proposed by U.S. Army Corps of Engineers-Huntsville.

2.0 UXO Team Composition

A UXO team will be on site during all sampling activities for anomaly avoidance on a site with known or suspected ordnance and explosives (OE).

- a) The UXO team will be composed of two UXO qualified personnel, depending on the tasks to be performed. One UXO team member will be a UXO Technician III and the other will be, as a minimum, a UXO Technician II. Qualifications of these personnel are published in Engineering Pamphlet 1110-1-18 and stated in Section 2.0 of the installation-wide OE management plan (IT, 2000).
- b) For the work to be performed in accordance with this work plan, IT will use a Schonstedt GA-72 magnetometer to assist in surface and subsurface sweeps. The Schonstedt GA-230 magnetometer will be the instrument used for downhole anomaly avoidance.
 - (1) A geophysical proveout test grid will be established and each geophysical instrument will be checked for operational reliability and calibration against this known response prior to field use each day. If calibration checks indicate that the instrument is not functioning within an acceptable range, and field adjustments do not resolve the performance discrepancy, the instrument will be tagged and removed from service.
 - (2) Preventive maintenance will be performed on a regularly scheduled basis. If an equipment problem is encountered, maintenance will be performed as soon as possible; records of the unscheduled maintenance and corrective action will be collected and retained for future reference.

3.0 Responsibilities

The UXO team member(s) will have the following responsibilities for anomaly avoidance procedures at the sites specified in this UXO safety plan.

- a) Provide the explosive ordnance recognition, location, and safety functions for IT employees and any subcontractors during sampling activities. Sampling activities include surface and subsurface soil sampling, drilling and sampling of monitoring wells, survey of sample points, and safe access and egress to the site.
- b) Conduct UXO safety briefings for all site personnel and visitors.

4.0 Authority

For this investigation, the UXO team will not perform any disposal activities. If the team identifies an OE item, it will clearly mark the item, and direct operations to another location for safe execution of the investigation. The UXO team will not destroy the item. The UXO team will report the item to the IT site manager and the FTMC transition force at FTMC for disposition of the item.

5.0 Anomaly Avoidance Procedures for Sampling Activities

When conducting sampling activities in the areas described in this work plan, consideration must be given for possible OE contamination. Since these areas may contain OE contamination, the UXO team must conduct a surface access survey and a subsurface survey of UXO before any type of activities commence, including foot and vehicular traffic.

a) Access Surveys.

- (1) The UXO team will conduct access surveys of the footpaths and vehicular lanes approaching and leaving each of the investigation sites. If UXO is found during the access survey, the ordnance will be conspicuously marked and avoided. No personnel will be allowed outside of the surveyed areas.
- (2) The UXO team will locate an access route to and from the proposed investigation site that is free of surface and near-surface UXO using an appropriate geophysical detection instrument as required. The access route should be as wide as the minimum number of feet of the widest vehicle.
- (3) Geophysical instrumentation should be used to locate potential UXO just below the surface that may be encountered through erosion from rain, continual vehicular traffic, or subsurface sampling and drilling activities. If surface UXO or subsurface UXO-related anomalies are encountered, the access route must be diverted to avoid contact.
- (4) The boundary of each access route and investigation site should be marked using white survey flagging and pin flags. Non-UXO qualified personnel will not be allowed outside designated access areas without proper UXO escort. Near-surface anomaly locations will be prominently identified with yellow survey flagging or pin flags. Red flagging will be placed adjacent to any discovered UXO for subsequent visual reference.

- (5) At the actual investigation site, the UXO team must also complete an access survey of an area sufficient to support mechanical excavation equipment maneuverability, parking of support vehicles, and establishment of decontamination stations as appropriate for site activities. As a minimum, the surveyed area should have a dimension in all directions equal to twice the length of the largest vehicle or piece of equipment to be brought on site. Intrusive activities will not proceed if an anomaly is detected that cannot be positively identified as inert material. In this event, the sampling personnel must select an alternate investigation area or configuration.
- b) **Surface/Near Surface-Sampling.** Surface soil samples are normally collected at depths of 0 to 12 inches below ground surface. The UXO team will visually survey the surface of the selected surface soil sampling sites for any indication of UXO or UXO-related contamination. In addition, the UXO team will utilize a magnetometer over the site before sampling begins. Any anomalies detected will be prominently marked with a yellow survey flag or pin flag for avoidance during sampling activities. If too many anomalies are found within an area of interest, the sampling personnel will select an alternate sampling location for collection of surface/near surface samples.
- c) **Subsurface Soil Sampling and Monitoring Well Installations.** Subsurface soil sampling is considered to be the collection of samples below a nominal depth of approximately 12 inches from a split-spoon, Shelby tube, or bucket auger soil sampler using drilling techniques. Drilling techniques are also used to install groundwater-monitoring wells for investigative sampling.
 - (1) The UXO team must conduct an access survey to locate an access route to the proposed sampling or drilling location as well as an access survey at the proposed drilling site that is large enough to support drill rig maneuverability, parking of support vehicles, and establishment of decontamination stations. As a minimum, the surveyed area should have a minimum dimension in all directions equal to twice the length of the largest vehicle or piece of equipment to be brought on site. The UXO team will clearly mark the boundaries of the cleared soil sampling or well site. Personnel will not go outside the cleared area. If a preselected area indicates magnetic anomalies, a new sampling/drilling site will be chosen.
 - (2) The UXO team must complete a subsurface geophysical survey of the proposed drill hole location(s). If the subsurface sampling depth is greater than the geophysical instrumentation detection capabilities below existing ground surface, then the UXO team must incrementally complete the geophysical survey as outlined below.

- (a) **Underground Utilities.** Utility clearance and/or excavation permits are not required for the areas covered by this document. In the event subsurface utilities are suspected in an excavation area, the UXO team must attempt to verify their location using geophysical instrumentation. Note that only utilities with a ferrous content are detectable with a geophysical instrument. All located utilities should be marked with a series of pin flags to visually delineate their approximate subsurface routing.
- (b) **Pilot Hole.** An incremental geophysical survey of the drill hole location(s) will be initially accomplished using a hand auger to install a pilot hole. An access survey of the immediate vicinity of the pilot hole location will precede its installation. The UXO team using a manual or mechanical portable auger will install the pilot hole. The augured hole will be inspected for anomalies with a geophysical instrument (configured for down hole utilization) at 2-foot increments as the hole is advanced below ground surface. The pilot hole will also be inspected with the geophysical instrument upon reaching the final depth of the hand auger providing a total clearance depth equal to pilot hole depth plus 2 feet. If the proposed site is still free of magnetic anomalies, the drilling equipment may be brought on site and utilized. Hand augering of a hole will not proceed if an anomaly is detected that cannot be positively identified as inert material. If OE is encountered or an anomaly cannot be positively identified as inert material, the sampling personnel must select a new drill hole location.
- (c) **Monitoring of Drilling by Others.** Once a drilling site has been surface cleared and a pilot hole installed as described above, the drilling contractor will be notified that the site is available for subsurface sampling or monitoring well installation. The drilling contractor's actual drill hole must be located within a 2-foot radius of the pilot hole installed by the UXO team. The UXO team will continue to complete a subsurface inspection for anomalies with a geophysical instrument configured for down hole utilization at 2-foot increments as the drilling is advanced from the clearance depth of the pilot hole until achievement of one of the following indicators: the drilling activity is completed; the drilling is extended to depths greater than 30 feet below ground surface; or a qualified geologist determines that virgin soil is found.
- (d) **Drilling equipment and/or metallic support materials (e.g., drill rig, augers, drill rods, casings, etc.)** may create an interference affecting the operation of the geophysical survey instrumentation during the incremental depth inspection process. In such event, the item(s) creating the interference must be relocated outside the interference range of the geophysical instrument during each incremental depth inspection of the drill hole for the presence of anomalies. Drilling of a hole will not proceed if OE is

encountered or if an anomaly is detected that cannot be positively identified as inert material. In this event, the sampling personnel must select a new drill hole location.

6.0 UXO/OE Disposition

Since the purpose of UXO support during activities is anomaly avoidance, the UXO team is not tasked to perform UXO/OE disposal. The UXO team will notify the site manager and the FTMC transition force if UXO is encountered that cannot be avoided or if the item presents an imminent hazard requiring immediate action based on the items fuzing or current condition. The UXO/OE item will be marked and recorded and all project personnel will evacuate the area.

7.0 Safety

In addition to the requirements of the site-specific safety and health plan prepared for this site, the UXO team will ensure the following:

- a) During the access and subsurface surveys conducted with a geophysical instrument, the UXO team members will not wear safety shoes or other footwear that would cause the instrument to present a false response.
- b) The UXO team will not be required to wear protective helmets unless a head threat is present.

8.0 Quality

A UXO quality control specialist is not required for this work. However, quality control instructions and procedures listed in Section 9.0 of the installation-wide OE management plan (IT, 2000) will be followed, as appropriate to this task.

9.0 Reference

IT Corporation (IT), 2000, *Final Installation-Wide Sampling and Analysis Plan, Fort McClellan, Calhoun County, Alabama*, March.